




## 1 2 4 5 6 9 10 : Priority check Points

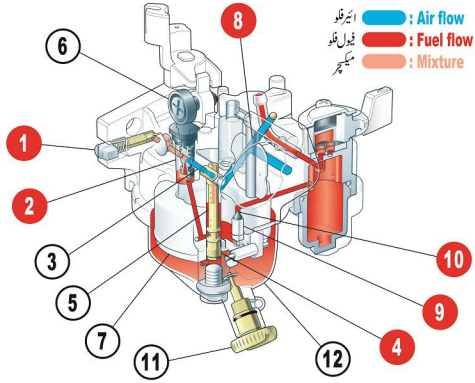

◆ Unstable idle speed  
◆ Poor performance at low speed

1 Pilot screw clogged. Remove foreign materials/dirt. Replace pilot screw.

2 Pilot jet clogged. Remove foreign materials/dirt.

3 Pilot jet air path clogged. Remove foreign materials/dirt.

◆ Engine does not start or stop  
◆ Hard starting  
◆ Engine starts but quickly stops

4 Main jet clogged. Remove foreign materials/dirt.

5 Main nozzle clogged. Remove foreign materials/dirt.

6 Profile stop screw position incorrect. Set correct idle speed.

7 Flood doesn't move properly. Remove foreign materials around float pin.

For long storage of the engine

اگر انجن کو لمبے عرصے کے لیے استعمال کرنے یا اسٹوریج کے لیے ہونا چاہئے تو اسٹوریج کے لیے ایسی پروسیجر استعمال کریں۔

Pilot screw and limiter cap replacement

پائلٹ اسکرو اور لیمر کپ کو تبدیل کرنا

Apply LOCTITE 638 LIMITER CAP STOPPER

Floet screw breaks of narrow point.

Using Carburetor Cleaning Kit (Kit No.07JFZ-0010000)

کاربوریٹر کولنگ کٹ کے استعمال کے لیے پروسیجر

Carburetor cleaning kit is useful to remove foreign materials/dirt.

Needle A (0.03) (Main jet)	Needle B (0.03) (Pilot jet)	Pump nozzle (Air blow to jet and Air path)	Screw driver (Main jet assembly/disassembly)
----------------------------	-----------------------------	--	--

◆ Engine speed does not increase  
◆ Poor performance at high speed  
◆ Unstable engine speed

1 Pilot screw clogged. Remove pilot screw. Replace pilot screw.

2 Pilot jet clogged. Remove foreign materials/dirt.

3 Pilot jet air path clogged. Remove foreign materials/dirt.

4 Main jet clogged. Remove foreign materials/dirt.

5 Main nozzle clogged. Remove foreign materials/dirt.

6 Pilot jet air path clogged. Remove foreign materials/dirt.

◆ Overflow  
◆ Gasoline leaks

اوریورلو  
پٹرول لیک

1 Float valve worn or coated with foreign materials/dirt. Remove foreign materials/dirt.

2 Valve seat worn or coated with foreign materials/dirt. Remove foreign materials/dirt.

Check of float chamber

فلوٹ چیمبر کو چیک کریں

فلوٹ ہیز کے تھریڈز کی جانچ کے لیے جس سے ہارڈ بڑھک کا سکتا ہے۔